


200VA（SY0408-475A1） R-core Power Transformer

1、Diagram

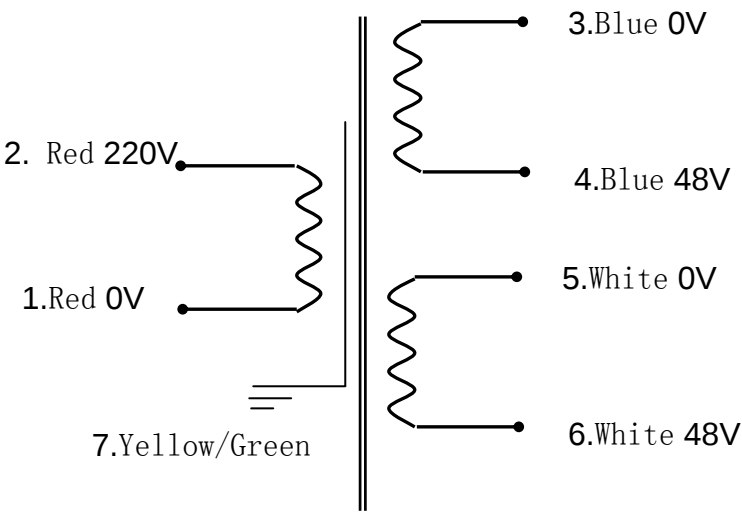

2、Performance

Name	Power	Outside Dimension		Weight	Pitch	Hole
	(VA)	A (mm)	X (mm)	(kg)	(mm)	(mm)
R-core Power Transformer	200	137	57	2. 4	100*85	ϕ 5
Primary Rate Input			220V 50Hz			
Primary Direct Current Resistance			20Ω			
No-load Current (Max)			20mA			
Secondary Rate Output						
	No-load Voltage (V±5%)		Load Voltage(V±5%)	Rated Load Current (A)		
S1 : 3 ~ 4	0~48		0~44.8	2.08		
S2 : 5 ~ 6	0~48		0~44.8	2.08		
Lead Wire Specification						
	Color		Specification	Length (mm)		Terminal
Primary Lead Wire : 1~2	Red-Red		RVV-0.75	200		Tin Imbrued 5mm
Secondary Lead Wire : 3~4 , 5~6	Blue-Blue , White-White		RV-0.75	200		Tin Imbrued 5mm