


400VA(SY06140-1311A1) R-core Power Transformer

1、Diagram

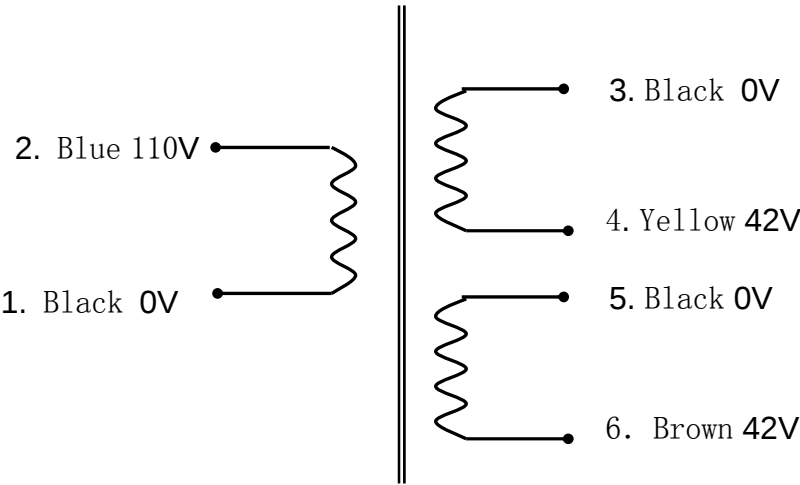

2、Performance

Name	Power	Outside Dimension		Weight (kg)	Pitch (mm)	Hole (mm)
	(VA)	A (mm)	X (mm)			
R-core Power Transformer	400	158	66	3.6	135*100	M5
Primary Rate Input			110V 50Hz			
Primary Direct Current Resistance			2 Ω			
No-load Current (Max)			35mA			
Secondary Rate Output						
	No-load Voltage (V±5%)		Load Voltage (V±5%)	Rated Load Voltage (A)		
S1: 3 ~ 4	0~42		0~40	5		
S2: 5~6	0~42		0~40	5		
Lead Wire Specification						
	Color		Specification	Length (mm)	Terminal	
Primary Lead Wire: 1~2	Black-Blue		UL-1015 16#	300	Tin Imbrued 5mm	
Secondary Lead Wire: 3~4, 5~6	Black-Yellow, Black-Brown		UL-1015 16#	300	Tin Imbrued 5mm	